



# Intel Cyclone 10 GX Device Errata and Design Guidelines



## Contents

---

<b>1 Intel® Cyclone® 10 GX Device Errata.....</b>	<b>3</b>
1.1 Automatic Lane Polarity Inversion for PCIe Hard IP.....	3
1.2 High $V_{CCBAT}$ Current when $V_{CC}$ is Powered Down.....	3
<b>2 Document Revision History.....</b>	<b>5</b>



## 1 Intel® Cyclone® 10 GX Device Errata

This errata sheet provides information about known device issues affecting Intel® Cyclone® 10 GX devices. The table below lists specific device issues and affected Intel Cyclone 10 GX devices.

**Table 1. Device Issues**

Issue	Affected Devices	Planned Fix
Automatic Lane Polarity Inversion for PCIe Hard IP on page 3	All Intel Cyclone 10 GX devices	No planned fix
High VCCBAT Current when VCC is Powered Down on page 3	All Intel Cyclone 10 GX devices	No planned fix

### 1.1 Automatic Lane Polarity Inversion for PCIe Hard IP

For Intel Cyclone 10 GX PCIe Hard IP open systems where you do not control both ends of the PCIe link, Intel does not guarantee automatic lane polarity inversion with the Gen1x1 configuration, Configuration via Protocol (CvP), or Autonomous Hard IP mode. The link may not train successfully, or it may train to a smaller width than expected. There is no planned workaround or fix.

For all other configurations, refer to the following workaround.

#### Workaround

Refer to the Knowledge Database in the related links below for details to workaround this issue.

#### Status

Affects: All Intel Cyclone 10 GX devices.

Status: No planned silicon fix.

#### Related Links

[Knowledge Database](#)

### 1.2 High V<sub>CCBAT</sub> Current when V<sub>CC</sub> is Powered Down

If you power off V<sub>CC</sub> when V<sub>CCBAT</sub> remains powered on, V<sub>CCBAT</sub> may draw higher current than expected.

If you use the battery to maintain volatile security keys when the system is not powered up, V<sub>CCBAT</sub> current could be up to 120 μA, resulting in shortened battery life.



### **Workaround**

Contact your battery provider to evaluate the impact to the retention period of the battery used on your board.

There is no impact if you connect the  $V_{CCBAT}$  to the on-board power rail.

### **Status**

Affects: All Intel Cyclone 10 GX devices

Status: No planned silicon fix.



## 2 Document Revision History

---

Date	Version	Changes
October 2017	2017.11.06	Initial release

---

Intel Corporation. All rights reserved. Intel, the Intel logo, Altera, Arria, Cyclone, Enpirion, MAX, Nios, Quartus and Stratix words and logos are trademarks of Intel Corporation or its subsidiaries in the U.S. and/or other countries. Intel warrants performance of its FPGA and semiconductor products to current specifications in accordance with Intel's standard warranty, but reserves the right to make changes to any products and services at any time without notice. Intel assumes no responsibility or liability arising out of the application or use of any information, product, or service described herein except as expressly agreed to in writing by Intel. Intel customers are advised to obtain the latest version of device specifications before relying on any published information and before placing orders for products or services.

\*Other names and brands may be claimed as the property of others.

**ISO  
9001:2008  
Registered**